

**Australia:** Contact Ferroxcube Taiwan  
Tel: +886 3 599 5886, Fax: +886 3 599 5882

**Austria:** Contact Ferroxcube Germany  
Tel: +49 40 52728 302, Fax: +49 40 52728 308

**Benelux:** Contact Ferroxcube Germany  
Tel: +49 40 52728 302, Fax: +49 40 52728 308

**Bosnia:** Contact Ferroxcube Italy  
Tel: +39 02 660454 69, Fax: +39 02 612917 39

**Brazil:** Richardson Electronics, Sao Paulo  
Tel: +55 11 5186 9672, Fax: +55 11 5186 9678

**Canada east:** Contact Ferroxcube, USA  
Tel: +1 (915) 599 2328, Fax: +1 (915) 599 2555

**China:** Ferroxcube South of China  
Tel: +86 769 87382420, Fax: +86 769 87339561  
Ferroxcube Suzhou  
Tel: +86 512 68095048, Fax: +86 512 68097128

**Colombia:** Richardson Electronics  
Tel: +57 1 636 1028, Fax: +57 1 636 1005

**Croatia:** Contact Ferroxcube Italy  
Tel: +39 02 660454 69, Fax: +39 02 612917 39

**Czech Republic:** Contact Ferroxcube Poland  
Tel: +48 46 834 00 07, Fax: +48 46 834 00 35

**Denmark:** Contact Ferroxcube Germany  
Tel: +49 40 52728 302, Fax: +49 40 52728 308

**Finland:** Contact Ferroxcube Germany  
Tel: +49 40 52728 302, Fax: +49 40 52728 308

**France:** Ferroxcube France, SURESNES  
Tel: +33 (0) 1 46 14 87 91, Fax: +33 (0) 1 46 14 87 92

**Germany:** Ferroxcube Germany, HAMBURG  
Tel: +49 40 52728 302, Fax: +49 40 52728 308

**Greece:** Contact Ferroxcube Italy  
Tel: +39 02 660454 69, Fax: +39 02 612917 39

**Hungary:** Contact Ferroxcube Poland  
Tel: +48 46 834 00 07, Fax: +48 46 834 00 35

**Indonesia:** Contact Ferroxcube Singapore  
Tel: +65 6244 7815, Fax: +65 6449 0446

**Ireland:** Contact Ferroxcube Germany  
Tel: +49 40 52728 302, Fax: +49 40 52728 308

**Israel:** Arrow/Rapac Ltd., PETACH TIKVA  
Tel: +972 3 9203480, Fax: +972 3 9203443

**Italy:** Ferroxcube Italy, CINISELLO BALSAMO (MI)  
Tel: +39 02 660454 69, Fax: +39 02 612917 39

**Korea:** Contact Ferroxcube Taiwan  
Tel: +886 3 599 5886, Fax: +886 3 599 5882

**Malaysia:** Contact Ferroxcube Singapore  
Tel: +65 6244 7815, Fax: +65 6449 0446

**Mexico (excl. Baja):** R.V. Componentes, Guadalajara, Mx  
Tel: +52 (33) 31 65 55 70, Fax: +52 (33) 31 65 46 63

**Mexico (Baja):** Contact Ferroxcube USA  
Tel: +1 619 207 0061, Fax: +1 619 207 0062

**Montenegro:** Contact Ferroxcube Italy  
Tel: +39 02 660454 69, Fax: +39 02 612917 39

**New Zealand:** Contact Ferroxcube Taiwan  
Tel: +886 3 599 5886, Fax: +886 3 599 5882

**Norway:** Contact Ferroxcube Germany  
Tel: +49 40 52728 302, Fax: +49 40 52728 308

**Philippines:** Contact Ferroxcube Singapore  
Tel: +65 6244 7815, Fax: +65 6449 0446

**Poland:** Ferroxcube Polska, SKIERNIEWICE  
Tel: +48 46 834 00 07, Fax: +48 46 834 00 35

**Portugal:** Contact Ferroxcube Hispano Ferritas S.A., SPAIN  
Tel: +34 949 247 153, Fax: +34 949 247 146

**Serbia:** Contact Ferroxcube Italy  
Tel: +39 02 660454 69, Fax: +39 02 612917 39

**Singapore:** Ferroxcube Singapore, SINGAPORE  
Tel: +65 6244 7815, Fax: +65 6449 0446

**Slovak Republic:** Contact Ferroxcube Poland  
Tel: +48 46 834 00 07, Fax: +48 46 834 00 35

**Slovenia:** Contact Ferroxcube Italy  
Tel: +39 02 660454 69, Fax: +39 02 612917 39

**South-Africa:** Contact Ferroxcube Germany  
Tel: +49 40 52728 302, Fax: +49 40 52728 308

**Spain:** Ferroxcube Hispano Ferritas S.A., SPAIN  
Tel: +34 949 247 153, Fax: +34 949 247 146

**Sweden:** Contact Ferroxcube Germany  
Tel: +49 40 52728 302, Fax: +49 40 52728 308

**Switzerland:** Contact Ferroxcube Germany  
Tel: +49 40 52728 302, Fax: +49 40 52728 308

**Taiwan:** Ferroxcube Taiwan, HSINCHU  
Tel: +886 3 599 5886, Fax: +886 3 599 5882

**Turkey:** Contact Ferroxcube Italy  
Tel: +39 02 660454 69, Fax: +39 02 612917 39

**United Kingdom:** Contact Ferroxcube Germany  
Tel: +49 40 52728 302, Fax: +49 40 52728 308

**United States:** Ferroxcube USA, EL PASO (TX)  
Tel: +1 915 599 2328/2533, Fax: +1 915 599 2555

For all other countries apply to closest regional sales office:

• HAMBURG, Germany  
Tel: +49 40 52728 302, Fax: +49 40 52728 308  
e-mail: saleseurope@ferroxcube.com

• EL PASO (TX), USA  
Tel: +1 915 599 2328/2533, Fax: +1 915 599 2555  
e-mail: salesusa@ferroxcube.com

• HSINCHU, Taiwan  
Tel: +886 3 599 5886, Fax: +886 3 599 5882  
e-mail: salesasia@ferroxcube.com

© Ferroxcube International Holding B.V. 2010

All rights are reserved. Reproduction in whole or in part is prohibited without the prior written consent of the copyright owner. The information presented in this document does not form part of any quotation or contract, is believed to be accurate and reliable and may be changed without notice. No liability will be accepted by the publisher for any consequence of its use. Publication thereof does not convey nor imply any license under patent- or other industrial or intellectual property rights.

Visit our web-site for the latest information on new products, application info as well as updated phone- and fax numbers

Internet: www.ferroxcube.com

Printed in Spain 9930 030 00011

Date of Release: March 2010



Run efficiently, run with  
**FERROXCUBE**  
all temperature ferrites

**3C97**

Extreme ferrites

for extreme conditions

# 3C97

Losses in power conversion systems based on ferrite transformers are mainly a consequence of copper windings and ferrite core losses themselves. Regarding the ferrite core losses, these are mainly determined by the magnetic flux density, frequency and by the operating temperature. Designers, by calculating such losses, predict transformer temperature rise at a determinate loading rate, then choosing the most appropriate conventional ferrite material minimize losses at the expected operating temperature.

## FERROXCUBE's new all temperature power ferrite. 3C97

FERROXCUBE extends its all temperature power ferrite range with a new power material: 3C97. This new grade complements our well known 3C95 in the search for high efficiency power conversion, especially in applications where large variations in operating temperatures occur.

Power conversion systems provided with FERROXCUBE 3C97 will not only offer high power density and reduced volume, but also increased efficiency when used in harsh environment applications with high ambient temperatures and wide temperature fluctuations.

FERROXCUBE, as the leading manufacturer in the ferrite industry, has been providing to the power conversion industry ferrite cores with the lowest power losses and highest saturation magnetic flux density over a wide range of operating frequencies (20KHz - 10MHz). This has allowed us to support today's manufacturers of power conversion systems in their drive for greater miniaturization, lower weight and reduced power consumption in applications where the temperature rise and maximum achievable temperature can be estimated.

However, in the last years countless power conversion applications, for

which a narrow operating temperature range cannot be assumed, are arising. Some examples are:

- Outdoors Solar inverters, Power-charging systems for electric vehicles.
- DC/DC converters for electric and hybrid cars, automotive electronics in general.
- Rugged systems suited to railway, heavy industry as well as others applications in adverse environments.

In the same way, since winding losses depend on the square of the current, power transformers efficiency varies depending on how much power is being given off. At reduced loads, the contribution of winding losses to the temperature rise of the transformer is minimum and since typical transformer designs are directed to minimize losses at steady state under full load, conventional ferrite materials will be out of their optimum loss point being the main cause for transformers reduced efficiency at low loads or stand-by states.

FERROXCUBE's all temperature power ferrite range will make the design of true high energy-efficient products possible, since the transformer will keep the industry's lowest loss levels independently of environmental temperature and loading.

New 3C97 power material is characterized by a flat Power density vs. Temperature curve between 60°C and 140°C achieving an improved efficiency over 3C95 in this temperature range.

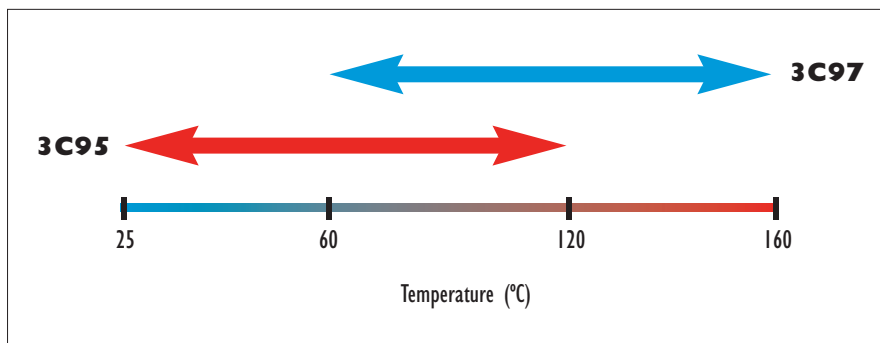


Figure 1. Recommended operating temperature for FERROXCUBE's all temperature power ferrites.

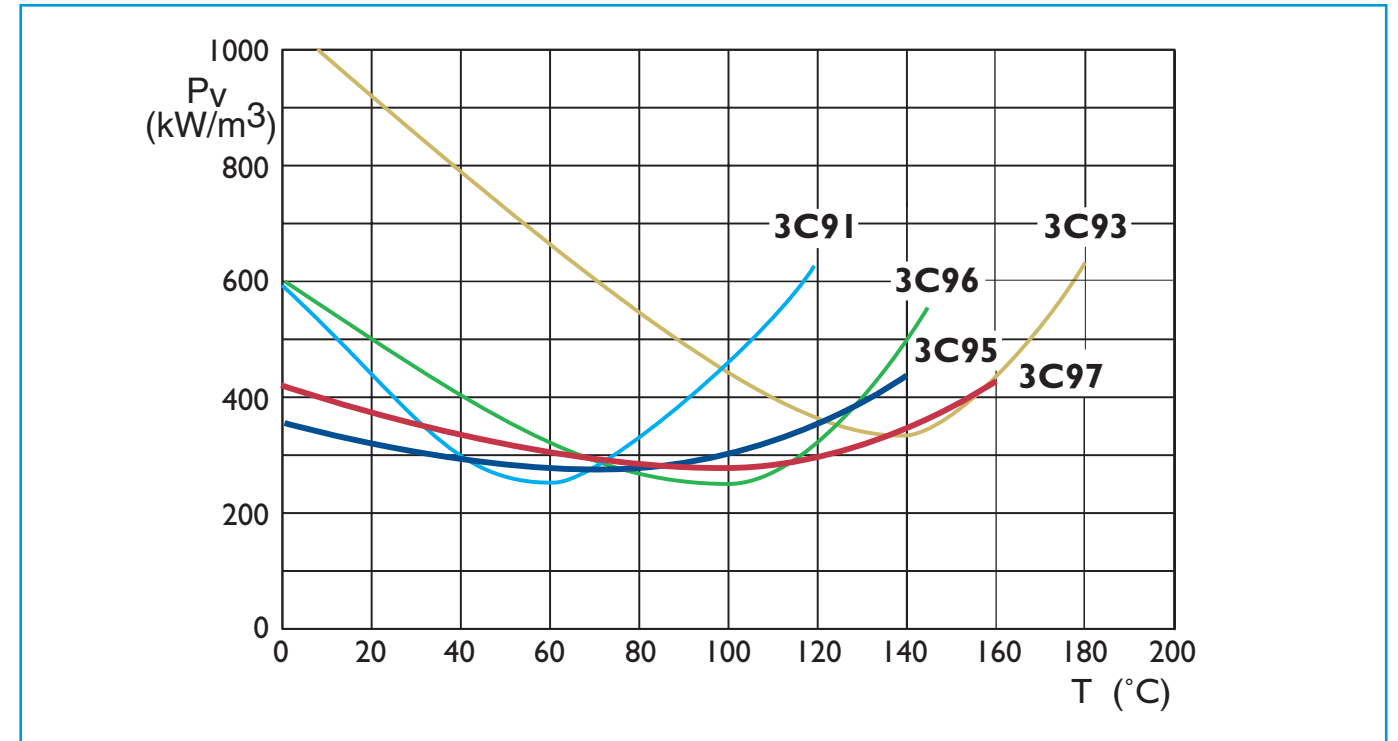


Figure 2. Loss density (100 kHz, 200mT) versus temperature for FXC's conventional power materials and new all temperature power ferrites (3C95, 3C97).

SYMBOL	CONDITIONS	VALUE	UNIT
$\mu_i$	25 °C; $\leq 10$ kHz; 0,25 mT	$3000 \pm 20\%$	
$\mu_a$	100 °C; 25 kHz; 200 mT	$\approx 5000$	
B	25 °C; 10 kHz; 1200 A/m	$\approx 530$	mT
	100 °C; 10 kHz; 1200 A/m	$\approx 410$	
$P_v$	60 °C; 100 kHz; 200 mT	$\approx 320$	kW/m <sup>3</sup>
	120 °C; 100 kHz; 200 mT	$\approx 320$	
	140 °C; 100 kHz; 200 mT	$\approx 380$	
$\rho$	DC, 25 °C	$\approx 5$	$\Omega\text{m}$
$T_c$		$\geq 215$	°C
density		$\approx 4800$	kg/m <sup>3</sup>

Figure 3. Material Characteristics.

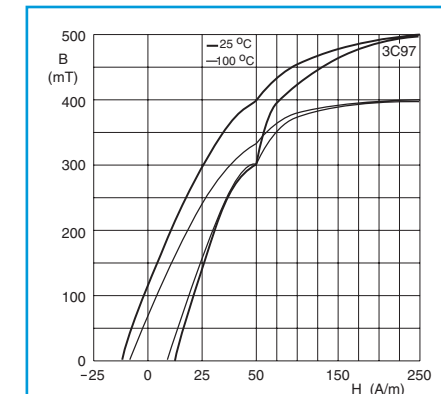


Figure 4. Typical B-H loops

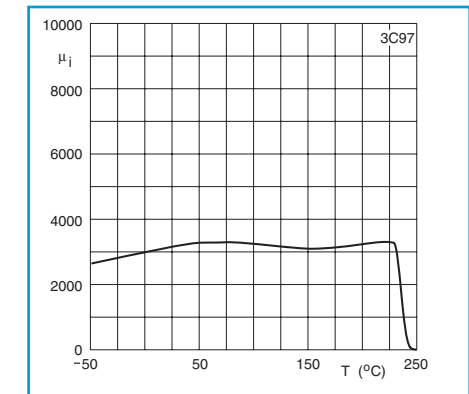


Figure 5. Initial permeability as function of temperature

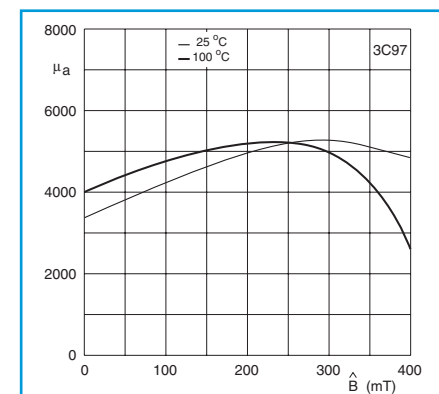


Figure 6. Amplitude permeability as function of peak flux density

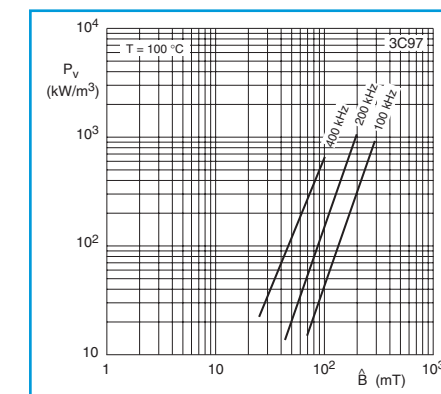


Figure 7. Specific power loss as function of peak flux density with frequency as a parameter

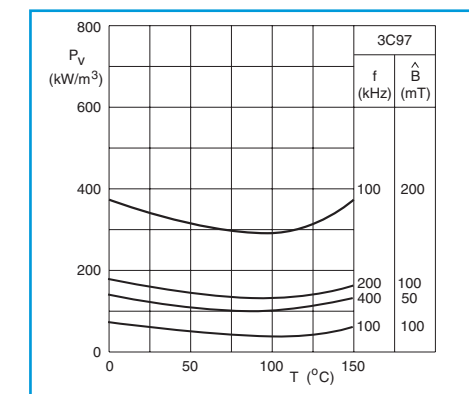


Figure 8. Specific power losses for several frequency/flux density combinations as a function of temperature